



PROHOME[®]

interior mouldings

FLOOR MOULDING

INSTALLATION

FOR DECORATING WALLS AND CEILINGS

Floor moulding installation

TOOLS AND MATERIALS



Spring tape measure



Lead pencil



Anglemeter



Miter saw



Rubber putty knife.
Stripping knife



Adhesive applicator gun



Protective gloves



Fine grain abrasive
paper



Cotton waste (Cloth)



Acetone.
White spirit



Fine grain
water-soluble filler

FOR DECORATING WALLS AND CEILINGS

ADHESIVE



G10.U.290
290 ml

G06.M.290
290 ml

G07.S.290
290 ml

G08.S.60
60 ml

The following information is relevant for Prohome adhesives. If you use other adhesives, follow manuals on it's package.

Work performance conditions: the temperature while performing the works and the next 24 hours must be at least + 8°C. Indoor relative air humidity must be 40%. It is required to keep the product in the room for 24 hours at least.

Requirements to the surface: prepared surface must be dry, degreased, cleaned from dust. Weak mineral substrates should be pre-strengthened by suitable primer.

Floor moulding installation

1



Using angle finder measure the angle of the corner of the room.

2



Set the angle on the trimming saw, make a cut on the product. In rooms with 90° corners it is possible to use a mitre box and a hand saw.

3



Apply G06M290 adhesive on the mounting surface (only in the area of junction to the wall) or G10U290 adhesive along the length of the product. The thickness of the applied layer of adhesive shall be 3-5 mm.

4



Affix the product to the place of installation according to the marking on the wall. Press the product along the whole length so that adhesive exudes from under the whole junction surface.

FOR DECORATING WALLS AND CEILINGS

5



Immediately after attaching remove excess adhesive using putty knife.

6



If necessary wipe the area of junction between the product and the wall with a cloth wetted with water if using G06M290 adhesive; with acetone if using G10U290 adhesive.

7



Cut the next product. Check the joining of the profile of products, if necessary redo the cut.

8



Wipe the end surfaces of abutting products with wet cloth to remove dust and other contaminants.

Floor moulding installation

9



Apply G08S60 / G07S290 adhesive on the end surface of already mounted product.

10



Apply G06M290 or G10U290 adhesive on the mounting surface (only in the area of junction to the wall) of the next product.

11



Press the product to the wall and floor, so that adhesive exudes from under the whole surface of junction. While moving the product along the wall, push it to the adjacent product so that adhesive exudes from the joint.

12



Immediately after attaching, remove excess adhesive using putty knife.

FOR DECORATING WALLS AND CEILINGS

13



Wipe the joint with cloth wetted with acetone.

14



Continue mounting the next product

15



After 3 hours sand the joints with fine sandpaper.

16



Fill the sanded joints with fine-grained, water-soluble filler for interior works, if necessary repeat «Step 15» until you get a flat surface (in 60 min.).

Floor moulding installation

17



Fill the joint of the product to the wall with adhesive in those areas where no adhesive exuded.

18



Wipe the excess adhesive with a cloth wetted with water if using G06M290 adhesive; with acetone if using G10U290 adhesive.

19



Paint the products, following directions from the paint manufacturer, starting from the corner of the room.







PROHOME[®]

Profhome Sweet Home

interior mouldings

<https://profhome.com>